(11) EP 1 172 868 A2

(12)

(43) Date of publication: 16.01,2002 Bulletin 2002/03 (51) Int Cl.7; H01L 39/24

- (21) Application number; 01401877.4
- (22) Date of filing: 13.07.2001
- (84) Designated Contracting States: AT BE CH CY DE DK ES FI FR GB GR IE IT LI LU MC NL PT SE TR
 - Designated Extension States: AL LT LV MK RO SI
- (30) Priority: 14.07.2000 JP 2000213583 15.02.2001 JP 2001038367
- (71) Applicant: Sumitomo Electric Industries, Ltd. Osaka (JP)

(72) Inventors:

EUROPEAN PATENT APPLICATION


- Kobayashi, Shinichi
 - 1-3, Shimaya 1-chome, Konohana-ku, Osaka (JP)
 - · Kaneko, Tetsuyuki
 - 1-3, Shimaya 1-chome, Konohana-ku, Osaka (JP)
- Hata, Ryosuke
- 1-3, Shimaya 1-chome, Konohana-ku, Osaka (JP)
- (74) Representative: Moutard, Pascal Jean et al Cabinet Beau de Loménie 158, rue de l'Université 75340 Paris Cedex 07 (FR)

(54) Method of preparing oxide superconducting wire and pressure heat treatment apparatus employed for the method

(57) The method of preparing an oxide superconducting wire comprises steps of preparing a wire by coating raw material powder for a Bi-Pi-Si-Ca-Cu-O based oxide superconductor including a 2223 phase with a metal and heat treating the wire in a pressurized atmosphere containing oxygen in a prescribed partial pressure, and the lotal pressure of the pressurized atmosphere is at least 0.5 MPa. The pressure heat treatment apparatus comprises a pressure furnace (1) stories.

ing and heat treating a target in a pressur/red atmosphere, a pressure regulator (3) for measuring the total pressure in the pressure furnace (1), an oxygen concentration meter (5) for measuring the oxygen concentrtion in the pressure furnace (1) and a controller (12) for controlling the oxygen partial pressure in the pressure furnace (1) in response to the total pressure measured by the pressure regulator (3) and the oxygen concentration measured by the oxygen concentration meter (5).

FIG.1

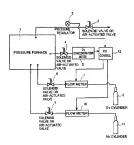

Printed by Jouve, 75001 PARIS (FR)

Description

BACKGROUND OF THE INVENTION

5 Field of the Invention

[0001] The present invention relates to a method of preparing an oxide superconducting wire and a pressure heat treatment apparatus employed for the method, and more particularly, it relates to a method of preparing an oxide superconducting wire capable of preventing the wire from expansion during sintering and a pressure heat treatment apparatus employed for the method.

Description of the Prior Art

- [0002] Generally known is a method of preparing an oxide superconducting wire by heat treating a wire obtained by charging a metal tube with raw material powder for an oxide superconductor and thereafter drawing or rolling the metal tube for sintering the raw material powder for the oxide superconductor. In the alforementioned heat treatment step for sintering, however, the wire is disadvantageously expanded to reduce superconductivity of the obtained oxide superconducting wire.
- [0003] Japanese Patent Laying-Open No. 5-101723 (1993) proposes a method of preparing an oxide superconduct-20 ing wire by heat treating a metal tube charged with powder of an oxide superconductor or a flat body thereof under a prossurized almosphere for sintenting the powder of the oxide superconductor. This gazette describes that a wire having excellent superconductivity is obtained by pressure heat treatment.
- [0004] More specifically, the metal tube charged with the powder of the oxide superconductor is stored in a heatresistant and pressure-resistant closed vessel to be prevented from expansion during sintering due to the internal pressure increased following temperature increase in the closed vessel. The internal pressure can be obtained from a state equation of gas or the like, and the aforementioned gazette describes that an internal pressure of about 4 atm. can be obtained with a healing temperature of about 800°C, for example.
- [0005] However, the internal pressure obtained following temperature increase in the closed vessel is only about 4 atm. (0.4 MPa), and it is difficult to sufficiently suppress expansion of the metal tube during sintering
- 2 [0006] Further, the internal pressure varies with the temperature in the closed vessel, leading to pressure reduction in the process of temperature increase up to the sintering temperature and in the process of temperature reduction to the room temperature after sintering. Therefore, expansion caused by gas generated at a temperature below the sintering temperature cannot be effectively prevented.

35 SUMMARY OF THE INVENTION

- [0007] An object of the present invention is to provide a method of preparing an oxide superconducting wire capable of effectively preventing expansion in a heat treatment step for sintering raw material powder for an oxide superconductor coated with a metal and obtaining an oxide superconducting wire having desired superconductivity and a pressure heat treatment appearance sembleved for this method.
- [0008] The method of preparing an oxide superconducting wire according to the present invention comprises steps of preparing a wire by coating with a metal raw material powder for a B-Pb-Sr-Ca-Cu-D based oxide superconductor containing bismuth, lead, strontium, calcium and copper and including a 2229 hase having composition railos of (bismuth and lead), strontium, calcium and copper approximately expressed as 2:2:2:3 and heat treating the wire in a pressur/zed atmosphere containing oxygen in a prescribed partial pressure, and the total pressure of the pressur/zed atmosphere is at least 0.5 MPa.
 - [0003] When the total pressure of the pressurized atmosphere is set to at least 0.5 MPa as described above, the wire can be inhibited from expansion caused by gas generated in the raw material powder for the oxide superconductor present in the wire.
- [0010] In the aforementioned method of preparing an oxide superconducting wire, the total pressure of the pressurized atmosphere is preferably kept at least 0.5 MPa from beginning to end of the heat treatment in the step of heat treatment the wire.
- [0011] The wire can be inhibited also from expansion caused by gas generated in the process of temperature increase and in the process of temperature reduction by keeping the total pressure of the pressurized atmosphere at least 0.5 MPa from the beginning of the process of temperature increase to the end of the process of temperature reduction.
 - on a long to beginning of the process of temperature increase to the end of the process of temperature reduction.

 [0012] In the derivementioned method of preparing an oxide superconducting wire, the oxygen partial pressure in the pressurized atmosphere is preferably at least 0.003 MPa and not more than 0.02 MPa. Further, the heat treatment temperature is preferably at least 800°C and not more than 840°C, and more preferably at least 810°C and not more than 840°C, and more preferably at least 810°C and not more than 840°C.

than 830°C in the step of heat treating the wire.

[0013] Superconductivity of the oxide superconducting wire such as the critical current can be improved by defining the oxygen partial pressure and/or the heat treatment temperature as described above.

[0014] The method of preparing an oxide superconducting wire according to the present invention preferably further comprises a step of preparing the raw material powder for the oxide superconductor by repeating pulverization and heat treatment.

[0015] Further, the method of preparing an oxide superconducting wire according to the present invention preferably further comprises a step of heat treating the raw material powder for the oxide superconductor under decompression and thereafter charging the aw material powder into a metal tube.

10 [0016] In the method of preparing an oxide superconducting wire according to the present invention, the step of preparing the wire preferably includes an operation of drawing the metal tube thereby preparing a wire coated with a metal. The step of preparing the wire preferably includes an operation of charging into another metal tube a plurally of wires obtained by drawing the metal tube and thereafter performing drawing and rolling on this metal tube thereby preparing a tabe-like wire.

5 [0017] The method of preparing an oxide superconducting wire according to the present invention is preferably applied to preparation of a wire consisting of a Bi-Pb-Sr-Ca-Cu-O based oxide superconductor, particularly oplimum when employing raw material powder for an oxide superconductor having composition ratios of (Bi - Pb), Sr, Ca and Cu approximately expressed as 2:2:23, and suitable for preparing a wire of a Bi-based oxide superconductor including a 2:233 phase having the afforementioned composition ratios, for example.

[0018] The pressure heat treatment apparatus employed for the method of preparing an oxide superconducting wire according to the present invention comprises a pressure heat treatment furnace storing a target for heat treating the target in a pressur/ex at drawsphere, a pressure measuring device for measuring the total pressure in the pressure heat treatment furnace, an oxygen concentration measuring device for measuring the oxygen concentration in the pressure heat treatment furnace and an oxygen partial pressure control part for controlling the oxygen partial pressure in the pressure measuring device and pressure heat treatment furnace in response to the total pressure measured by the pressure measured by the pressure measuring device and

the oxygen concentration measured by the oxygen concentration measuring device.

[0019] In the pressure heal treatment apparatus having the aforementioned structure, the oxygen partial pressure in the pressure heat treatment fumace can be precisely controlled. When this pressure heat treatment apparatus is employed for the method of preparing an oxide superconducting wire according to the present invention, the oxygen partial pressure in the pressur/zed atmosphere can be precisely controlled in the step of heat treating the wire, thereby

readily obtaining an oxide superconducting wire having superconductivity such as a desired critical current. [0220] The pressure heat treatment apparatus according to the present invention preferably further comprises a gas introduction device for introducing oxygen gas or non-oxygen gas into the pressure heat treatment furnace in response to a control single dubut from the oxygen partial pressure control part.

[0021] In this case, the oxygen partial pressure in the pressure heat treatment furnace can be readily controlled by simply introducing oxygen gas or non-oxygen gas into the pressure heat treatment furnace.

[0022] According to the inventive method of preparing an oxide superconducting wire, as hereinabove described, the wire can be effectively inhibited from expansion in the heat treatment step, while superconductivity such as the critical current can be improved by controlling the oxygen partial pressure in the pressure heat treatment apparatus according to the present invention, further, the oxygen partial pressure in the pressure heat treatment apparatus according to the present invention, further, the oxygen partial pressure in the pressure heat treatment apparatus is employed for the method of preparing an oxide superconducting wire according to the present invention, the oxygen partial pressure in the pressured atmosphere can be precisely controlled in the step of heat treatment when, thereby readily obtaining an oxide superconducting wire having superconductivity such as a desired oritical current as a result.

[0023] The foregoing and other objects, features, aspects and advantages of the present invention will become more apparent from the following detailed description of the present invention when taken in conjunction with the accompanying drawing.

50 BRIEF DESCRIPTION OF THE DRAWING

[0024] Fig. 1 schematically illustrates the structure of a pressure heat treatment apparatus employed for a method of preparing an oxide superconducting wire according to the present invention.

55 DESCRIPTION OF THE PREFERRED EMBODIMENTS

[0025] In the method disclosed in Japanese Patent Laying-Open No. 5-101723, the metal tube is conceivably prevented from expansion since the metal tube is pressed from outside with the same pressure as that expanded in the

metal tube when gas present in clearances (the filling factor is generally about 80 % of the theoretical density before sintering) in the powder of the oxide superconductor stored in the metal tube is volume-expanded at a high temperature. If the metal tube is not expanded in this case, the volumes in the metal tube and the pressure vessel remain constant and hence the pressures in the metal tube and the pressure vessel storing the metal tube are changed when the sintering temperature is increased.

[0026] When the inventor studied the cause of expansion of such a wire, however, it was recognized that adsorbates such as carbon (C), water (H₂O) and oxygen (O₂) adhering to raw material powder for an oxide superconductor are vaporized during sintering to exert remarkable influence on volume expansion in a metal tube, leading to expansion of the wire. The inventor has discovered that the total pressure in a pressurized atmosphere for heat treating the wire must be at least 5 atm. (0.5 MPa) in order to suppress expansion caused not only by gas present in the clearances between grains forming the raw material powder for the oxide superconductor but also by vaporization of adsorbates adhering to the surfaces of the oranis.

[0027] In a method of charging raw material powder for an oxide superconductor into a metal tube and thereafter heat treating the obtained wire, the powder adsorbs or contains various types of gas, and hence the gas present in the clearances between the grains forming the raw material powder is liberated during the heat treatment to expand the wire. This liberation of the gas and the expansion caused by the gas exert bad influence on the oxide superconducting wire.

[0028] Also when the gas is homogeneously liberated as a whole in a small quantity, the liberated gas penetrates into the clearances between the exide superconducting cystal grains to hinder connection between the cystal grains, i.e. electrical connection. Thus, the characteristic of the obtained oxide superconducting wire, particularly the critical

[0029] In a tape-like oxide superconducting wire of 0.24 mm in thickness and 3.2 to 3.6 mm in width having a number of oxide superconductor filaments of 10 µm in thickness and 100 µm in width, for example, each oxide superconductor filament is formed by an aggregate of oxide superconductor crystal gains of 2 µm in thickness and 10 µm in width. While a current flows between the crystal grains of the oxide superconductor in this case, the path of the current is

hindered when gas is present between the crystal grains.

[0030] When the gas is locally largely liberated, large expansion is caused to deform the shape of the wire itself on the part exposed to this gas liberation and locally reduce the critical current.

[0031] As means of suppressing the aforementioned liberation of gas, a method of heat treating the wire with pressurfization is proposed in Japanese Patent Laying-Open No. 5-101723, for example, as described above. However, this method, capable of suppressing expansion caused by gas liberation only when the gas is homogeneously liberated as a whole in a small cuentity, is insufficient for suppressing expansion caused by gas liberation when the gas is locally largely liberated.

[0032] In the method of preparing an oxide superconducting wire according to the present invention, the wire can abe effectively prevented from expansion caused by gas liberation whether the gas is homogeneously liberated as a whole in a small quantity or locally largely liberated, by setting the total pressure of the pressurized atmosphere to at least 1.5 MP.

[0033] In the method disclosed in Japanese Patent Laying-Open No. 5-101723, the pressure applied to the wire through the closed vessel varies with the temperature in the dosed vessel. When the wire is heat treated, gas components such as H₂O, CO₂ and O₂ are generated in the wire, i.e., in the metal tube, H₂O, CO₂ and O₂ are generated in temperature regions of 100 to 300°C, 700 to 800°C and 800 to 900°C respectively, in order to suppress such gas components generated from the inner part of the wire by applying a pressure to the outer side of the wire, a nexternal pressure must be applied at a temperature of at least 100°C. In the method disclosed in the aforementioned gazette, however, the pressure is reduced in response to the temperature in the closed vessel in the process of temperature increase up to the heat treatment temperature and in the process of temperature reduction after the heat treatment, and hence the wire cannot be prevented from expansion caused by generation of the aforementioned gas components in the temperature reduction after the heat treatment.

[0034] In the method of preparing an oxide superconducting wire according to the present invention, the total pressure of the pressurfixed atmosphere is preferably kept at least 0.5 MPa in the overall step of heat treating the wire, i.e., from the starting point of the heat treatment in the process of temperature increase to the end point of the heat treatment in the process of temperature increase to the end point of the heat treatment in the process of temperature region of less than 100°C as well as at the end point of the heat treatment within the temperature region of less than 100°C, whereby the wire can be inhibited also from expansion caused by gas generated in a temperature region of less than 100°C, whereby the wire can be inhibited also from expansion caused by gas generated in a temperature region below the heat treatment temperature.

[0035] In the method of preparing an oxide superconducting wire according to the present invention, the wire, heat treated in the present/zed atmosphere of at least 5 atm. (0.5 MPa), can be inhibited from expansion caused by gas generation in the wire. Particularly when the length of the wire, exceeds 10 m, it is believed that the gas is naturally and entirely liberated from end portions of the wire, and hence the effect according to the inventive method is further

increased. Thus, superconductivity of the obtained oxide superconducting wire can also be improved by suppressing expansion of the wire.

[0036] In relation to preparation of a bismuth-based oxide superconductor having a 2223 phase, it is known that the 2223 phase is stably generated when the wire is heat treated under such a condition that the heat treatment atmosphere for sintering contains oxygen in the ratio of 20 to 3 % with respect to a total pressure of 1 atm. When pressure heat treatment is performed on the wire as disclosed in Japanese Patent Laying-Open No. 5-101723, however, the 2223 phase may not be stably generated even if the wire is heat treated in a pressurized atmosphere with a gas mixture containing oxygen in the aforementioned ratio. When the powder of the oxide superconductor is sintered in a closed vessel having an internal pressure of about 4 atm. in a gas mixture containing about 80 % of nitrogen and about 20 % of oxygen, i.e., in the air, the oxygen partial pressure reaches 0.8 atm, in response to the oxygen content. The inventor has found that this oxygen pressure is out of a condition for stably generating the 2223 phase of the bismuth-based oxide superconductor. The inventor has also found that the 2223 phase of the bismuth-based oxide superconductor can be stably generated when the oxygen partial pressure in the pressurized atmosphere is kept at 0.03 to 0.2 atm. (0.003 to 0.02 MPa), even if the total pressure of the pressurized atmosphere is changed. In order to heat treat the wire in a pressurized atmosphere of 10 atm., for example, a gas mixture containing 0.3 to 2 % of oxygen must be employed for performing heat treatment so that the oxygen partial pressure is 0.03 to 0.2 atm. In order to stably generate the phase of the oxide superconductor, it is extremely important to properly control the oxygen partial pressure condition also when expansion can be suppressed by performing heat treatment in the pressurized atmosphere.

[0037] In the method of preparing an oxide superconducting wire according to the present invention, therefore, the oxygen partial pressure in the pressurized atmosphere is preferably controlled to at least 0.03 MPa and not more than 0.02 MPa also when changing the total pressure of the pressurized atmosphere. In other words, the oxygen content in the pressurized atmosphere is preferably varied with the total pressure of the pressurized atmosphere, in order to control the oxygen partial pressure in the pressurized atmosphere within the aforementioned range. Thus, the 223 ohase of the oxide superconduction wire can be stably enerrated.

[0038] As to the structure of the oxide superconducting wire, the periphery of oxide superconductor filaments is coated with a metal such as silver or a silver alloy. Therefore, the oxygen partial pressure on the oxide superconductor filaments generated in the wire shardly equivalent to the oxygen partial pressure around the oxide superconductor, the oxygen partial pressure in the wire can be forcibly controlled to a desired value by maintaining the pressur/ad atmosphere under conditions of an oxygen partial pressure desirable for generating the phase of the oxide superconductor and increasing the total pressure of the pressur/ad atmosphere. Therefore, the raw material powder for the oxide superconductor is more densely sintered and the critical current of the oxide superconducting wire can be increased by increasing the pressure of the atmosphere. Therefore, the raw material powder for the oxide superconductor is more densely sintered and the critical current of the oxide superconducting wire can be increased by increasing the pressure of the atmosphere when heat treating the wire.

[0039] As hereinabove described, the oxygen partial pressure in the pressurized atmosphere is more preferably of controlled in the method of preparing an oxide superconducting wire according to the present invention. The reaction for generating the target phase of the oxide superconductor can be improved, the wire can be prevented from expansion in the pressure heat treatment, and superconductivity can be improved by adjusting the oxygen content in the pressurized atmosphere in response to the total pressure in the pressurized atmosphere and controlling the oxygen partial pressure to a desired level, i.e., at least 0.003 MPa and not more than 0.02 MPa. Thus, the wire can be inhibited from 0 local deterioration caused by expansion and an oxide superconducting wire excellent in superconductivity can be provided by employing the inventive method.

[0040] In the method of preparing an oxide superconducting wire according to the present invention, the heat treatment temperature is more preferably controlled in response to the oxygen partial pressure in the pressurize that the preferably controlled within the range of at least 780°C and not more than 85°C with respect to the oxygen partial pressure of at least 0.003 MPa and not more than 0.02 MPa, while the heat treatment remperature is more preferably controlled within the range of at least 80°C and not more than 84°C and further preferably controlled within the range of at least 81°C and not more than 830°C in order to improve superconductivity such as the critical current.

[0041] Fig. 1 schematically shows the structure of a pressure heat treatment apparatus employed for the method of preparing an oxide superconducting wire according to the present invention. As shown in Fig. 1, a pressure furnace 1 serving as a pressure heat treatment furnace stores a target such as a wire for pressurizing/heat treating the target. A closed vessel such as a high-temperature isostatic pressing (HIP) vessel or the like may be employed as the pressure furnace 1. An exhaust valve 2 discharges gas from the pressure furnace 1. A passure regulator 3 regulates and measures the total pressure in the pressure furnace 1. A gas delivery valve 4 delivers the gas from the pressure furnace 1, so that an oxygen concentration meter 5 measures the oxygen concentration thereof. An electric signal corresponding to the value of the total pressure in the pressure furnace 1 regulated and measured by the pressure regulator 3 and an electric signal corresponding to the oxygen concentration in the gas stored in the pressure furnace 1 measured by the oxygen concentration meter 5 are transmitted to a controller 12. The controller 12 college concentration as ontrol signal for

controlling the oxygen partial pressure in the pressure furnace by PID (proportional integral and differential) control in response to the aforementioned two electric signals, and supplies the control signal to an oxygen flow meter? and a introgen flow meter 10. If the oxygen partial pressure calculated from the measured total pressure and oxygen concentration is less than a prescribed set value, a necessary amount of oxygen as regulated by the oxygen flow meter? Is ted into the pressure furnace 1 from an oxygen cylinder 8 through an oxygen introduction valve 6 until the oxygen partial pressure reaches the prescribed set value. If the aforementioned calculated oxygen partial pressure is nexcess of the prescribed set value to the contrary, a necessary amount of nitrogen gas regulated by the nitrogen flow meter 10 in response to the control signal is fed into the pressure furnace 1 from a introgen cylinder 1 through a nitrogen introduction valve 9. The oxygen gas or nitrogen gas must be fed while controlling the total pressure in the pressure

furnace 1 and maintaining the same at a constant value by the pressure regulator 3. [0042] The pressure heat treating a wire prepared by coating raw material powder for a Bi-Pb-Sr-Ca-Cu-O based oxide superconductor including a 2223 phase with a metal. This wire is stored in the pressure turnace 1. The pressure regulator 3 keeps the total pressure in the pressure furnace 1 at least 0.5 MPa from a starting point of heat treatment in the process of temperature increase in the pressure furnace 1 to an end point of heat treatment in the process of temperature increases in the pressure furnace 1 to an end point of heat treatment in the process of temperature reduction in the pressure furnace 1.6 mecessary amount of oxygen gos regulated by the oxygen flow meter 7 is feld from the oxygen oxylinder 8 into the pressure furnace 1 from the nitrogen regulated by the nitrogen flow meter 10 is fed into the pressure furnace 1 from the nitrogen regulated by the nitrogen introduction valve 9 until the oxygen partial pressure calculated from the total pressure regulated by the pressure regulator 3 and the oxygen concentration measured by the oxygen concentration meter 5 reaches a prescribed value within the range of at least 0.03 MPa and not more than 0.22 MPa. When the oxygen partial pressure reaches the prescribed value, the oxygen introduction valve 6 and the nitrogen introduction valve 9 are closed. Thereafter the wire is heat treated.

(Example 1)

[0043] Powder materials of compounds Bl₂O₃, PbO, SrO₃, CacO₃, and CuO were mixed with each other to prepare a powder mixture containing Bl, Pb, Sr, Ca and Cu in the ratios 1.82:0.33:1.92:2.01:3.02 as raw material powder for a bismuth-based oxide superconductor. This powder mixture was heat treated at a temperature of 750°C for 10 hours, and thereafter further heat treated at a temperature of 800°C for 8 hours. The heat treated powder mixture was pulverized in an automatic mortar. The powder obtained by this pulverization was heat treated at a temperature of 850°C for 4 hours, and thereafter pulverized in the automatic mortar again.

[0044] The powder obtained in the aforementioned manner was heat treated under decompression, and thereafter charged into a silver pipe of 36 mm in outer diameter and 30 mm in inner diameter. Then, the silver pipe of 43 mm in the powder was drawn. 61 wires obtained in this manner were bundled and engaged in a silver pipe of 36 mm in outer diameter and 31 mm in inner diameter, which in turn was subjected to drawing and rolling. The rolling was performed with a draft of about 80 %. Thus, tape-like wires of 0.25 mm in thickness and 3.6 mm in width were obtained.

[0045] The wires of the blemuth-based oxide superconductor having a 2223 phase prepared in the dorementioned danner were superposed with each other through a clearance member of ceramic paper consisting of a mixture of alumina (fiber and zirconia powder, and wound on a spool of a stainless alloy having a cliameter of 50 cm. A prescribed pressure was applied to the superposed wires and thereafter heating was started to heat treat the superposed wires under prescribed conditions. After the heat treatment, the wires were cooled to the room temperature, and thereafter the pressure was removed.

[0046] As shown in Table 1, the total pressure of the pressurized atmosphere was varied in the range of 0.1 to 20.0 MPa, for performing first heat treatment on the wires of respective samples. In each sample, the oxygen partial pressure, the heat treatment temperature and the heat treatment time were set to 0.02 MPa, 840°C and 50 hours respectively. Thereafter the wire of each sample was rolled with a rolling reduction of about 15 %, and thereafter the total pressure of the pressurized atmosphere was varied in the range of 0.1 to 20.0 MPa as shown in Table 1 for performing second heat treatment. In each sample, the oxygen partial pressure, the heat treatment temperature and the heat treatment time were set to 0.02 MPa, 835°C and 50 hours respectively. After the heat treatment, the degree of expansion of the wires was evaluated and the critical current was measured at a temperature of 77 K. Table 1 also shows the results.

55

Table 1

Sample No.	Total Pressure (MPa)	Oxygen Partial Pressure (Mpa)	Heat Treatment Temperature (°C)		Heat Treatment Time (Hr)	Critical Current (A)	Expansion of Wire
			first	second			
1	0.1	0.02	840	835	50	45	yes
2	0.2	0.02	840	835	50	45	yes
3	0.3	0.02	840	835	50	46	yes
4	0.4	0.02	840	835	50	47	yes
5	0.5	0.02	840	835	50	47	no
6	0.8	0.02	840	835	50	49	no
7	1.0	0.02	840	835	50	55	no
8	1.5	0.02	840	835	50	56	no
9	2.0	0.02	840	835	50	65	no
10	3.0	0.02	840	835	50	68	no
11	5.0	0.02	840	835	50	70	no
12	10.0	0.02	840	835	50	82	no
13	20.0	0.02	840	835	50	98	no
	No. 1 2 3 4 5 6 7 8 9 10 11	No. Pressure (MPa) 1 0.1 2 0.2 3 0.3 4 0.4 5 0.5 6 0.8 7 1.0 8 1.5 9 2.0 10 3.0 11 5.0 12 10.0	No. Pressure (MPa) Partial Pressure (MPa) 1 0.1 0.02 2 0.2 0.02 3 0.3 0.02 4 0.4 0.4 0.02 6 0.8 0.02 7 1.0 0.02 8 1.5 0.02 9 2.0 0.02 10 3.0 0.02 11 5.0 0.02 12 10.0 0.02	No. Pressure (MPa) Partial Pressure (Mpa) Tempers (Mpa) 1 0.1 0.02 840 2 0.2 0.02 840 3 0.3 0.02 840 4 0.4 0.02 840 5 0.5 0.02 840 6 0.8 0.02 840 7 1.0 0.02 840 8 1.5 0.02 840 9 2.0 0.02 840 10 3.0 0.02 840 11 5.0 0.02 840 12 10.0 0.02 840	No. Pressure (MPa) Partial Pressure (Mpa) Timperature (*C) 1 0.1 0.02 840 835 2 0.2 0.02 840 835 3 0.3 0.02 840 835 4 0.4 0.02 840 835 5 0.5 0.02 840 835 6 0.8 0.02 840 835 7 1.0 0.02 840 835 8 1.5 0.02 840 835 9 2.0 0.02 840 835 10 3.0 0.02 840 835 11 5.0 0.02 840 835 11 5.0 0.02 840 835 12 10.0 0.02 840 835	No. Pressure (MPa) Partial Pressure (Mpa) Temperature (*C) Treatment Time (Hr) 1 0.1 0.02 840 835 50 2 0.2 0.02 840 835 50 3 0.3 0.02 840 835 50 4 0.4 0.02 840 835 50 5 0.5 0.02 840 835 50 6 0.8 0.02 840 835 50 7 1.0 0.02 840 835 50 8 1.5 0.02 840 835 50 9 2.0 0.02 840 835 50 10 3.0 0.02 840 835 50 11 5.0 0.02 840 835 50 11 5.0 0.02 840 835 50 12 10.0 0.02 840 835 50 <td>No. Pressure (MPa) Parlial Pressure (Mpa) Temperature (°C) Treatment Time (Hr) Current (A) 1 0.1 0.02 840 835 50 45 2 0.2 0.02 840 835 50 46 3 0.3 0.02 840 835 50 46 4 0.4 0.02 840 835 50 47 5 0.5 0.02 840 835 50 47 6 0.8 0.02 840 835 50 49 7 1.0 0.02 840 835 50 55 8 1.5 0.02 840 835 50 55 9 2.0 0.02 840 835 50 56 10 3.0 0.02 840 835 50 65 11 5.0 0.02 840 835 50 65 11</td>	No. Pressure (MPa) Parlial Pressure (Mpa) Temperature (°C) Treatment Time (Hr) Current (A) 1 0.1 0.02 840 835 50 45 2 0.2 0.02 840 835 50 46 3 0.3 0.02 840 835 50 46 4 0.4 0.02 840 835 50 47 5 0.5 0.02 840 835 50 47 6 0.8 0.02 840 835 50 49 7 1.0 0.02 840 835 50 55 8 1.5 0.02 840 835 50 55 9 2.0 0.02 840 835 50 56 10 3.0 0.02 840 835 50 65 11 5.0 0.02 840 835 50 65 11

[0047] It is clearly understood from Table 1 that the degree of expansion of the wire depends on the total pressure of the pressurized atmosphere such that no effect of suppressing expansion of the wire is attained if the total pressure of the pressurized atmosphere is not more than 0.4 MPa while an effect of suppressing expansion of the wire is attained if the total pressure exceeds 0.5 MPa. It is also understood that the critical current of the wire is also improved as the total pressure of the pressurized atmosphere is increased.

[0048] In the aforementioned Example 1, the heat treatment is performed twice in order to attain desired superconductivity, i.e., a desired critical current. In elation to confirmation of the effect of suppressing expansion of the wire is attained if the total pressure of the pressure

(Example 2)

[0049] Tape-like wires of a bismuth-based oxide superconductor were prepared similarly to Example 1.7 The wires were superposed with each other through a clearance member of ceramic paper consisting of a mixture of aluma fiber and zirconia powder, and the superposed wires were wound on a spool of a stainless alloy having a clameter of 50 cm.

Thereafter pressurization starting conditions and depressurization starting conditions were varied as shown in Table 2, for healt treating the wires of respective samples with a total pressure of 1.0 MPa, an oxygen partial pressure of 0.02 MPa and a heat treatment imperature of 840°C for a heat treatment time of 50 hours. After the heat treatment, the degrees of expansion of the wires were evaluated. Table 2 also shows the results.

5

10

15

20

25

30

35

40

45

50

55

Expansion yes ves yes ves yes Ves ves yes yes yes Ves. 9 in the process of temperature Depressurization Starting during heat treatment during heat treatment during heat treatment during heat treatment (temperature) Condition after cooled to room after cooled to room temperature (30°C) after cooled to room temperature (30°C) after cooled to room temperature (30°C) temperature (30°C) reduction (700°C) reduction (700°C) reduction (700°C) reduction (700°C) (840°C) (840°C) (840°C) (840°C) during heat treatment during heat treatment during heat treatment Pressurization Starting during temperature during temperature during temperature during temperature during temperature during temperature before temperature efore temperature sefore temperature (temperature) reduction (800°C) reduction (800°C) reduction (800°C) increase (500°C) increase (500°C) increase (500°C) Condition ncrease (29°C) increase (29°C) increase (29°C) (840°C) (840°C) (840°C) Treatment Heat Lime Œ 20 20 S 20 20 င္ဟ 20 20 20 20 20 ය Tomperature Treatment Heat 340 349 840 840 840 840 840 840 g 340 840 340 Pressure Oxygen Partial (MPa) 0.02 0.03 0.02 0.02 0.02 0.02 0.02 0.02 0.02 0.02 0.02 0.02 Pressure (MPa) Total 0 0 0 0 1.0 0 0.1 1.0 1.0 0 0.1 0.1 Table 2 Sample Ξ 2 10 11 18 S 2 21 53 23 24 25 Ę

[0050] It is clearly understood from Table 2 that an effect of suppressing expansion of the wire can be attained in the

processes of temperature increase and temperature reduction by starting pressurization before increasing the temperature and starting depressurization after cooling the wire to the room temperature in the step of heat treating the wire in a pressurized atmosphere. In other words, it is understood that the wire is expanded if the total pressure of the pressurized atmosphere is not kept in the prescribed range of at least 0.5 MPa from the process of temperature increase as the start point of the heat treatment in the pressurized atmosphere and to the process of temperature reduction as the end point of the heat treatment.

(Example 3)

[0051] Tape-like wires of a bismuth-based oxide superconductor were prepared similarly to Example 1. The wires were superposed with each other through a clearance member of ceramic paper consisting of a mixture of alumina fiber and zirconia powder, and the superposed wires were wound on a spool of a stainless alloy having a cliameter of 50 cm. A prescribed pressure was applied to the superposed wires and thereafter heating was started to heat treat the superposed wires under prescribed conditions. After the heat treatment, the wires were cooled to the room temperature, and thereafter the pressure was removed.

[0052] First heat treatment was performed on the wires of respective samples in a pressurized atmosphere having a total pressure of 1.0 MPa and an oxygen partial pressure of 0.005 MPa at a temperature of 810°C for 50 hours. Thereafter rolling was performed on the wires with a rolling reduction of about 15 %, and then second heat treatment was performed while varying the oxygen partial pressure in the pressurized atmosphere in the range of 0.2 to 0.001 MPa, as shown in Table 9. After the heat treatment, the degree of expansion of the wires was evaluated and the critical current was reassured at a temperature of 77 K. Table 3 also shows the results.

Toble 2

				Table 3			
25	Sample No.	Total Pressure (MPa)	Oxygen Partial Pressure (MPa)	Heat Treatment Temperature (°C)	Heat Treatment Time (Hr)	Critical Current (A)	Expansion of Wire
	26	1.0	0.2	835	50	0	по
30	27	1.0	0.02	835	50	45	по
	28	1.0	0.018	832	50	60	no
	29	1.0	0.01	815	50	65	no
35	30	1.0	0.005	805	50	71	no
	31	1.0	0.003	800	50	68	по
	32	1.0	0.001	795	50	51	no

[0053] It is clearly understood from Table 3 that the wire was inhibited from expansion in each sample. This is because the total pressure of the pressurized atmosphere was 1.0 MPa.

[0054] While it was impossible to confirm superconduction in the sample No. 26 heat treated with the oxygen partial pressure of 0.2 MPa, the samples Nos. 27 to 32 heat treated in the pressurized atmospheres having oxygen partial pressures of not more than 0.02 MPa exhibited excellent superconductivity with high critical currents. It is understood that a higher critical current can be obtained with a lower heat treatment temperature as the oxygen partial pressure is reduced, regardless of the lotal pressure of the pressurized strengspiere. It is also understood that the heat treatment temperature is preferably in the range of 800 to 830°C, in order to obtain a relatively high critical current. The sample No. 32 heat treated in the pressurized atmosphere having an oxygen partial pressure of less than 0.033 MPa (0.010 MPa) exhibited a lower critical current as compared with the samples Nos. 2.8 to 31 heat treated in the pressurized atmosphere having an oxygen partial pressures of all teast 0.003 MPa.

(Example 4)

[0055] Tape-like wires of a bismuth-based oxide superconductor were prepared similarly to Example 1. The wires were superposed with each other through a clearance member of ceramic paper consisting of a mixture of alumina fiber and direonia powder, and the superposed wires were wound on a spool of a stainless alloy having a diameter of 50 cm. A prescribed pressure was applied to the superposed wires and thereafter heating was started to heat treat the superposed wires under prescribed conditions. After the heat treatment, the wires were cooled to the room terms.

perature, and thereafter the pressure was removed.

[0056] First heat treatment was performed on the wires of respective samples in a pressurized atmosphere having a total pressure of 2.0 MPa and an oxygen partial pressure of 0.005 MPa at a temperature of 810°C for 50 hours. Thereafter rolling was performed on the wires with a rolling reduction of about 15 %, and then second heat treatment was performed while varying the oxygen partial pressure in the pressurized atmosphere in the range of 0.2 to 0.001 MPa, as shown in Table 4. After the heat treatment, the degree of expansion of the wires was evaluated and the critical current was measured at a temperature of 77 K. Table 4 also shows the results.

Table 4

				Iable 4			
10	Sample No.	Total Pressure (MPa)	Oxygen Partial Pressure (MPa)	Heat Treatment Temperature (°C)	Heat Treatment Time (Hr)	Critical Current (A)	Expansion of Wire
15	33	2.0	0.2	835	50	0	no
	34	2.0	0.02	830	50	63	no
	35	2.0	0.01	815	50	68	no
	36	2.0	0.008	810	50	70	no
20	37	2.0	0.001	795	50	43	no

[0057] It is clearly understood from Table 4 that the wire was inhibited from expansion in each sample. This is because the total pressure of the pressurized atmosphere was 2.0 MPa.

[0058] While it was impossible to confirm superconduction in the sample No. 32 heat treated with the oxygen partial pressure of 2.0 MPa, the samples Nos. 34 to 37 heat treated in the pressurized atmospheres having oxygen partial pressures of not more than 0.02 MPa exhibited excellent superconductivity with high critical currents. It is understood that a higher critical current can be obtained with a lower heat treatment temperature as the oxygen partial pressure is reduced, regardless of the total pressure of the pressurized atmosphere. It is also understood that the heat treatment temperature is preferably in the range of 810 to 830°C, in order to obtain a relatively high critical current. The sample No. 37 heat treated in the pressurized atmosphere having an oxygen partial pressure of less than 0.003 MPa (0.001 MPa) oxhibited a lower critical current as compared with the samples Nos. 34 to 36 heat treated in the pressurized atmosphere having an oxygen partial pressures of all less though MPa.

35 (Example 5)

55

[0059] Tape-like wires of a bismuth-based oxide superconductor were prepared similarly to Example 1. The wires were superposed with each other through a clearance member of ceramic paper consisting of a mixture of alumina fiber and zinconia powder, and the superposed wires were wound on a spool of a stainless alloy having a cliameter of 50 cm. A prescribed pressure was applied to the superposed wires and thereafter heating was started to heat treat the superposed wires under prescribed conditions. After the heat treatment, the wires were cooled to the room temperature, and thereafter the pressure was removed.

[0060] First heat treatment was performed on the wires of respective samples in a pressurized atmosphere having a total pressure of 3.0 MPa and an oxygen partial pressure of 0.005 MPa at a temperature of 810°C for 50 hours. Thereafter rolling was performed on the wires with a rolling reduction of about 15 %, and then second heat treatment was performed while varying the oxygen partial pressure in the pressurized atmosphere in the range of 0.2 to 0.001 MPa, as shown in Table 5. After the heat treatment, the degree of expansion of the wires was evaluated and the critical current was measured at a temperature of 77. Kalbé 5 also shows the results.

Table 5

Sample No.	Total Pressure (MPa)	Oxygen Partial Pressure (MPa)	Heat Treatment Temperature (°C)	Heat Treatment Time (Hr)	Critical Current (A)	Expansion of Wire
38	3.0	0.2	835	50	0	по
39	3.0	0.02	830	50	65	по

Table 5 (continued)

5	Sample No.	Total Pressure (MPa)	Oxygen Partial Pressure (MPa)	Heat Treatment Temperature (°C)	Heat Treatment Time (Hr)	Critical Current (A)	Expansion of Wire
	40	3.0	0.015	812	50	70	no
	41	3.0	0.012	810	50	72	no
10	42	3.0	0.005	800	50	68	no
	43	3.0	0.001	795	50	45	no

[0061] It is clearly understood from Table 5 that the wire was inhibited from expansion in each sample. This is because the total pressure of the pressurized atmosphere was 3.0 MPa.

[062] While it was impossible to confirm superconduction in the sample No. 38 heat treated with the oxygen partial pressure of 0.2 MPa, the samples No. 35 to 43 heat treated in the pressurized atmospheres having oxygen partial pressures of 0.2 MPa, the samples No. 35 to 43 heat treated in the pressurized atmospheres having oxygen partial pressures of not more than 0.02 MPa exhibited excellent superconductivity with high critical current. It is understood that a higher critical current can be obtained with a lower heat treatment temperature as the oxygen partial pressure of the sample of the oxygen partial pressured is reduced, regardless of the total pressure of the pressurized atmosphere. It is also understood that the heat treatment temperature is preferably in the range of 800 to 830°C, in order to obtain a relatively high critical current. The sample No. 43 heat treated in the pressurized atmosphere having an oxygen partial pressure of less than 0.03 MPa (0.03 MPa) exhibited a lower critical current as compared with the samples Nos. 39 to 42 heat treated in the pressurized atmospheres having oxygen partial pressures of the table 0.03 MPa (0.03 MPa) exhibited a lower critical current as compared with the samples Nos. 39 to 42 heat treated in the pressurized atmospheres having oxygen partial pressures of the least 0.00 MPa) exhibited a lower critical current as compared with the samples Nos. 39 to 42 heat treated in the pressurized atmospheres having oxygen partial pressures of at least 0.00 MPa) exhibited at least 0.00 MPa) exhibited at least 0.00 MPa (0.04 MPa) exhibited at least 0.00 MPa) exhibited at least

25 (Example 6)

40

[0063] Tape-like wires of a bismuth-based oxide superconductor were prepared similarly to Example 1. The wires were superposed with each other through a clearance member of ceramic paper consisting of a mixture of alumina fiber and zirconia powder, and the superposed wires were wound on a spool of a stalinies alloy having a diameter of 50 cm. A prescribed pressure was applied to the superposed wires and thereafter heating was started to heat treat the superposed wires under prescribed conditions. After the heat treatment, the wires were cooled to the room temperature, and thereafter the pressure was removed.

[0064] First heat treatment was performed on the wires of respective samples in a pressurized atmosphere having a total pressure of 1.0 MPa and an oxygen partial pressure of 0.01 MPa at a temperature of 810°C for 50 hours. Thereafter rolling was performed on the wires with a rolling reduction of about 15 %, and then second heat treatment was performed while varying the heat treatment temperature in the range of 845 to 805°C, as shown in Table 6. After the heat treatment, the degree of expansion of the wires was evaluated and the critical current was measured at a temperature of 77 K. Table 6 also shows the results.

Table 6

				I GIDIO O			
45	Sample No. No.	Total Pressure (MPa)	Oxygen Partial Pressure (MPa)	Heat Treatment Temperature (°C)	Heat Treatment Time (Hr)	Critical Current (A) (A)	Expansion of Wire
	44	1.0	0.01	830	50	24	no
50	45	1.0	0.01	825	50	47	no
	46	1.0	0.01	820	50	60	no
50	47	1.0	0.01	815	50	65	no
	48	1.0	0.01	810	50	52	no
55	49	1.0	0.01	805	50	40	no
	50	1.0	0.02	845	50	38	no
	51	1.0	0.02	840	50	50	no

Table 6 (continued)

5	Sample No. No.	Total Pressure (MPa)	Oxygen Partial Pressure (MPa)	Heat Treatment Temperature (°C)	Heat Treatment Time (Hr)	Critical Current (A) (A)	Expansion of Wire
	52	1.0	0.02	835	50	58	по
	53	1.0	0.02	830	50	56	no
10	54	1.0	0.02	825	50	48	no
	55	1.0	0.02	820	50	41	по

[0065] It is clearly understood from Table 6 that the wire was inhibited from expansion in each sample. This is because the total pressure of the pressurized atmosphere was 1.0 MPa.

[0066] When the oxygen partial pressure was 0.01 MPa, the samples Nos. 46 to 48 heat treated at the temperatures of 810 to 820°C exhibited relatively high critical currents. When the oxygen partial pressure was 0.02 MPa, the samples Nos. 51 to 53 heat treated at the temperatures of 830 to 840°C exhibited relatively high critical currents.

[0067] Although the present invention has been described and illustrated in detail, it is clearly understood that the same is by way of illustration and example only and is not to be taken by way of limitation, the scope of the present invention being limited only by the terms of the appended claims.

Claims

25

30

40

- 1. A method of preparing an oxide superconducting wire comprising steps of:
 - proparing a wire by coating a metal raw material powder for a Bi-Pb-Sr-Ca-Cu-O based oxide superconductor containing bismuth, lead, strontium, calcium and copper and including a 2223 phase having composition ratios of (bismuth and lead), strontium, calcium and copper approximately expressed as 2:2:2:3; and
 - heat treating said wire in a pressurized atmosphere containing oxygen in a prescribed partial pressure, wherein the total pressure of said pressurized atmosphere is at least 0.5 MPa.
- The method of preparing an oxide superconducting wire according to claim 1, wherein the total pressure of said pressurized atmosphere is kept at least 0.5 MPa from beginning to end of heat treatment in said step of heat treating said wire.
 - The method of preparing an oxide superconducting wire according to claim 1 or 2, wherein the oxygen partial pressure in said pressurized atmosphere is at least 0.003 MPa and not more than 0.02 MPa.
- 4. The method of preparing an oxide superconducting wire according to claim 1, 2 or 3, wherein the heat treatment temperature is at least 800°C and not more than 840°C in said step of heat treating said wire.
- 5. The method of preparing an oxide superconducting wire according to claim 4, wherein the heat treatment temperature is at least 810°C and not more than 830°C in said step of heat treating said wire.
 - The method of preparing an oxide superconducting wire according to any one of claims 1 to 5, further comprising a step of preparing said raw material powder for said oxide superconductor by repeating pulverization and heat treatment.
 - 7. The method of preparing an oxide superconducting wire according to any one of claims 1 to 6, further comprising a step of heat treating said raw material powder for said oxide superconductor under decompression and thereafter charging said raw material powder into a metal tube.
- The method of preparing an oxide superconducting wire according to claim 7, wherein said step of preparing said wire includes an operation of drawing said metal tube thereby preparing a wire coated with a metal.
 - 9. The method of preparing an oxide superconducting wire according to claim 8, wherein said step of preparing said

wire includes an operation of charging into another metal tube a plurality of wires obtained by drawing said metal tube and thereafter performing drawing and rolling on this metal tube thereby preparing a tape-like wire.

10. A pressure heat treatment apparatus comprising:

20

25

30

35

an

45

55

a pressure heat treatment furnace (1) storing a target for heat treating said target in a pressur/zed aimosphere; pressure measuring means (3) if measuring the total pressure in said pressure heat treatment furnace (1); oxygen concentration measuring means (5) for measuring the oxygen concentration in said pressure heat treatment furnace (1); and

oxygen partial pressure control means (12) for controlling the oxygen partial pressure in said pressure heat treatment furnace (1) in response to the total pressure measured by said pressure measuring means (3) and the oxygen concentration measuring means (5).

11. The pressure heal treatment apparatus according to claim 10, further comprising gas introduction means (6, 7, 8, 9, 10, 11) for introducing oxygen gas or non-oxygen gas into said pressure heal treatment furnace (1) in response to a control signal output from said oxygen partial pressure control means (12).

FIG.1

